

Safety Data Sheet

Zero Rust 68SP Safety Blue (Aerosol)

SDS Revision Date:

02/27/2015

1. Identification

1.1. Product identifier

Product Identity Zero Rust 68SP Safety Blue (Aerosol)
Alternate Names LHB Part Number: 0654---350

1.2. Relevant identified uses of the substance or mixture and uses advised against

Intended use See Product Label.
Application Method See Product Label.

1.3. Details of the supplier of the safety data sheet

Company Name AMTECO, Inc.
P.O. Box 9
Pacific, MO 63069

Emergency

24 hour Emergency Telephone No. (800) 424-9300 (Chemtrec)
Customer Service: AMTECO, Inc. (800) 969-4811

2. Hazard(s) identification

2.1. Classification of the substance or mixture

Flam. Gas 1;H220	Extremely flammable gas.
Press. Gas;H280	Contains gas under pressure; may explode if heated.
Acute Tox. 5;H303	May be harmful if swallowed. (Not adopted by US OSHA)
Skin Irrit. 2;H315	Causes skin irritation.
Eye Irrit. 2;H319	Causes serious eye irritation.
Repr. 2;H361D	Suspected of damaging the unborn child.
STOT SE 3;H336	May cause drowsiness or dizziness.
STOT RE 2;H373	May cause damage to organs through prolonged or repeated exposure. Specific Target Organs: (Not Available)
Simple Asphyxiant	May displace oxygen and cause rapid suffocation.

2.2. Label elements


Using the Toxicity Data listed in section 11 and 12 the product is labeled as follows.

Safety Data Sheet

Zero Rust 68SP Safety Blue (Aerosol)

SDS Revision Date:

02/27/2015

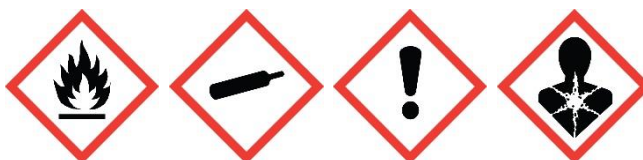

Danger

H220 Extremely flammable gas.

H280 Contains gas under pressure; may explode if heated.

H303 May be harmful if swallowed.

H315 Causes skin irritation.

H319 Causes serious eye irritation.

H336 May cause drowsiness and dizziness.

H361d Suspected of damaging the unborn child.

H373 May cause damage to organs through prolonged or repeated exposure.

May displace oxygen and cause rapid suffocation.

[Prevention]:

P201 Obtain special instructions before use.

P202 Do not handle until all safety precautions have been read and understood.

P210 Keep away from heat / sparks / open flames / hot surfaces - No smoking.

P261 Avoid breathing dust / fume / gas / mist / vapors / spray.

P262 Do not get in eyes, on skin, or on clothing.

P264 Wash thoroughly after handling.

P271 Use only outdoors or in a well-ventilated area.

P280 Wear protective gloves / eye protection / face protection.

[Response]:

P301+310 IF SWALLOWED: Immediately call a POISON CENTER or doctor / physician.

P302+352 IF ON SKIN: Wash with plenty of soap and water.

P304+312 IF INHALED: Call a POISON CENTER or doctor / physician if you feel unwell.

P305+351+338 IF IN EYES: Rinse continuously with water for several minutes. Remove contact lenses if present and easy to do - continue rinsing.

P308+313 IF exposed or concerned: Get medical advice / attention.

P314 Get Medical advice / attention if you feel unwell.

P321 Specific treatment (see information on this label).

P331 Do NOT induce vomiting.

P332+313 If skin irritation occurs: Get medical advice / attention.

P337+313 If eye irritation persists: Get medical advice / attention.

Safety Data Sheet

Zero Rust 68SP Safety Blue (Aerosol)

SDS Revision Date:

02/27/2015

P340 Remove victim to fresh air and keep at rest in a position comfortable for breathing.

P362 Take off contaminated clothing and wash before reuse.

P377 Leaking gas fire - do not extinguish unless leak can be stopped safely.

P381 Eliminate all ignition sources if safe to do so.

[Storage]:

P403+233 Store in a well ventilated place. Keep container tightly closed.

P405 Store locked up.

P410 Protect from sunlight.

[Disposal]:

P501 Dispose of contents / container in accordance with local / national regulations.

3. Composition/information on ingredients

This product contains the following substances that present a hazard within the meaning of the relevant State and Federal Hazardous Substances regulations.

Ingredient/Chemical Designations	Weight %	GHS Classification	Notes
Acetone CAS Number: 0000067-64-1	10 - 25	Flam. Liq. 2;H225 Eye Irrit. 2;H319 STOT SE 3;H336	[1][2]
Propane CAS Number: 0000074-98-6	10 - 25	Flam. Gas 1;H220 Press. Gas;H280	[1][2]
Butane CAS Number: 0000106-97-8	1.0 - 10	Flam. Gas 1;H220 Press. Gas;H280	[1][2]
Toluene CAS Number: 0000108-88-3	1.0 - 10	Flam. Liq. 2;H225 Repr. 2;H361d Asp. Tox. 1;H304 STOT RE 2;H373 Skin Irrit. 2;H315 STOT SE 3;H336	[1][2]
Solvent naphtha (petroleum), light aromatic CAS Number: 0064742-95-6	1.0 - 10	Asp. Tox. 1;H304	[1]
Propane, 2-methyl- CAS Number: 0000075-28-5	1.0 - 10	Flam. Gas 1;H220 Press. Gas;H280	[1][2]
N-Butyl Acetate CAS Number: 0000123-86-4	1.0 - 10	Flam. Liq. 3;H226 STOT SE 3;H336	[1][2]
Methyl Propyl Ketone CAS Number: 0000107-87-9	1.0 - 10	Flam. Liq. 2;H225 Acute Tox. 4;H302 Eye Irrit. 2;H319 STOT SE 3;H335 Skin Irrit. 2;H315	[1][2]
PM Acetate CAS Number: 0000108-65-6	1.0 - 10	Flam. Liq. 3;H226	[1]

Safety Data Sheet

Zero Rust 68SP Safety Blue (Aerosol)

SDS Revision Date:

02/27/2015

[1] Substance classified with a health or environmental hazard.

[2] Substance with a workplace exposure limit.

[3] PBT-substance or vPvB-substance.

*The full texts of the phrases are shown in Section 16.

4. First aid measures

4.1. Description of first aid measures

General	In all cases of doubt, or when symptoms persist, seek medical attention. Never give anything by mouth to an unconscious person.
Inhalation	Remove to fresh air, keep patient warm and at rest. If breathing is irregular or stopped, give artificial respiration. If unconscious place in the recovery position and obtain immediate medical attention. Give nothing by mouth.
Eyes	Irrigate copiously with clean water for at least 15 minutes, holding the eyelids apart and seek medical attention.
Skin	Remove contaminated clothing. Wash skin thoroughly with soap and water or use a recognized skin cleanser.
Ingestion	DO NOT INDUCE VOMITING. Give nothing by mouth. Get immediate medical attention.

4.2. Most important symptoms and effects, both acute and delayed

Overview	<p>ROUTES OF EXPOSURE: Exposure may be by INHALATION and/or SKIN or EYE contact, depending on conditions of use. To minimize exposure, follow recommendations for proper use, ventilation, and personal protective equipment.</p> <p>EFFECTS OF OVEREXPOSURE: Irritation of eyes, skin and upper respiratory system. May cause nervous system depression. Extreme overexposure may result in unconsciousness and possibly death.</p> <p>SIGNS AND SYMPTOMS OF OVEREXPOSURE: Headache, dizziness, nausea, and loss of coordination are indications of excessive exposure to vapors or spray mists. Redness and itching or burning sensation may indicate eye or excessive skin exposure.</p> <p>MEDICAL CONDITIONS AGGRAVATED BY EXPOSURE: None generally recognized.</p> <p>CANCER INFORMATION: For complete discussion of toxicology data refer to Section 11. Exposure to solvent vapor concentrations from the component solvents in excess of the stated occupational exposure limits may result in adverse health effects such as mucous membrane and respiratory system irritation and adverse effects on the kidneys, liver and central nervous system. Symptoms include headache, nausea, dizziness, fatigue, muscular weakness, drowsiness and in extreme cases, loss of consciousness.</p> <p>Repeated or prolonged contact with the preparation may cause removal of natural fat from the skin resulting in dryness, irritation and possible non-allergic contact dermatitis. Solvents may also be absorbed through the skin. Splashes of liquid in the eyes may cause irritation and soreness with possible reversible damage. See section 2 for further details.</p>
Inhalation	May cause drowsiness or dizziness.
Eyes	Causes serious eye irritation.

Safety Data Sheet

Zero Rust 68SP Safety Blue (Aerosol)

SDS Revision Date:

02/27/2015

Skin Causes skin irritation.
Ingestion May be harmful if swallowed. (Not adopted by US OSHA)

5. Fire-fighting measures

5.1. Extinguishing media

Carbon Dioxide, Dry Chemicals, Foam

5.2. Special hazards arising from the substance or mixture

Hazardous decomposition: Carbon Monoxide and Carbon Dioxide

Keep away from heat / sparks / open flames / hot surfaces - No smoking.

Avoid breathing dust / fume / gas / mist / vapors / spray.

Do not get in eyes, on skin, or on clothing.

5.3. Advice for fire-fighters

Do not expose to temperatures over 120°F. Keep away from heat, sparks and flame. Containers may explode when exposed to extreme heat. Applications to hot surfaces require special precautions. During emergency conditions, overexposure to decomposition products may cause a health hazard. Symptoms may not be immediately apparent. Obtain medical attention.

Water may be used to keep fire-exposed containers cool.

Fire fighters should wear full protective clothing, including self-contained breathing equipment.

ERG Guide No. 126

6. Accidental release measures

6.1. Personal precautions, protective equipment and emergency procedures

Put on appropriate personal protective equipment (see section 8).

6.2. Environmental precautions

Dispose of in accordance with applicable Federal, State & Local regulations. Remove ignition sources and work with non-sparking tools. Use oil absorbent materials.

Use good personal hygiene practices. Wash hands before eating, drinking, smoking or using toilet. Promptly remove soiled clothing and wash thoroughly before reuse.

6.3. Methods and material for containment and cleaning up

Avoid inhalation. Use good ventilation. Read entire label before using and follow all label directions.

Safety Data Sheet

Zero Rust 68SP Safety Blue (Aerosol)

SDS Revision Date:

02/27/2015

7. Handling and storage

7.1. Precautions for safe handling

Keep out of reach of children. Keep away from heat sparks, and open flame. Vapors will accumulate readily and may ignite explosively. During use and until all vapors are gone: Keep area ventilated- Do Not Smoke- Extinguish all flames, pilot lights, and heaters – Turn off stoves, electric tools and appliances, and any other source of ignition. Consult NFPA Code. Use approved Bonding and Grounding procedures. Contents under pressure. Do not puncture, incinerate, or expose to temperatures above 120°F. Heat from sunlight, radiators, stoves, hot water, and other heat sources could cause container to burst. Do not take internally. Keep out of reach of children.

See section 2 for further details. - [Prevention]:

7.2. Conditions for safe storage, including any incompatibilities

Handle containers carefully to prevent damage and spillage.

Incompatible materials: Oxidizing agents, strong acids.

Category NFPA 30B Level 2 Aerosol

Do not store where temperatures may exceed 120F (48.9C)

See section 2 for further details. - [Storage]:

7.3. Specific end use(s)

No data available.

8. Exposure controls and personal protection

8.1. Control parameters

Exposure

CAS No.	Ingredient	Source	Value
0000067-64-1	Acetone	OSHA	TWA 1000 ppm (2400 mg/m3)STEL 2400 mg/m3
		ACGIH	TWA: 250 ppm STEL: 500 ppm Skin
		NIOSH	250 ppm (590 mg/m3) TWA
		Supplier	No Established Limit
0000074-98-6	Propane	OSHA	TWA 1000 ppm (1800 mg/m3)
		ACGIH	Ensure Minimal Oxygen Content (ACGIH appendix F)
		NIOSH	TWA 1000 ppm (1800 mg/m3)
		Supplier	No Established Limit
0000075-28-5	Propane, 2-methyl-	OSHA	No Established Limit
		ACGIH	STEL: 1000ppm
		NIOSH	TWA 800 ppm (1900 mg/m3)
		Supplier	No Established Limit

Safety Data Sheet

Zero Rust 68SP Safety Blue (Aerosol)

SDS Revision Date:

02/27/2015

0000106-97-8	Butane	OSHA	No Established Limit
		ACGIH	TWA: 600 ppm STEL: 750 ppm
		NIOSH	TWA 800 ppm (1900 mg/m3)
		Supplier	No Established Limit
0000107-87-9	Methyl Propyl Ketone	OSHA	TWA 200 ppm (700 mg/m3)
		ACGIH	TWA: 150 ppm STEL: 250 ppm
		NIOSH	TWA 150 ppm (530 mg/m3)
		Supplier	No Established Limit
0000108-65-6	PM Acetate	OSHA	No Established Limit
		ACGIH	TWA: 50 ppm STEL: 75 ppm
		NIOSH	No Established Limit
		Supplier	No Established Limit
0000108-88-3	Toluene	OSHA	TWA 200 ppm C 300 ppm 500 ppm (10-minute maximum peak)STEL 150 ppm
		ACGIH	TWA: 20 ppmR
		NIOSH	TWA 100 ppm (375 mg/m3) ST 150 ppm (560 mg/m3)
		Supplier	No Established Limit
0000123-86-4	N-Butyl Acetate	OSHA	TWA 150 ppm (710 mg/m3)
		ACGIH	TWA: 20 ppmS
		NIOSH	TWA 150 ppm (710 mg/m3) ST 200 ppm (950 mg/m3)
		Supplier	No Established Limit
0064742-95-6	Solvent naphtha (petroleum), light aromatic	OSHA	No Established Limit
		ACGIH	No Established Limit
		NIOSH	No Established Limit
		Supplier	No Established Limit

Carcinogen Data

CAS No.	Ingredient	Source	Value
0000067-64-1	Acetone	OSHA	Select Carcinogen: No
		NTP	Known: No; Suspected: No
		IARC	Group 1: No; Group 2a: No; Group 2b: No; Group 3: No; Group 4: No;
0000074-98-6	Propane	OSHA	Select Carcinogen: No
		NTP	Known: No; Suspected: No
		IARC	Group 1: No; Group 2a: No; Group 2b: No; Group 3: No; Group 4: No;
0000075-28-5	Propane, 2-methyl-	OSHA	Select Carcinogen: No
		NTP	Known: No; Suspected: No
		IARC	Group 1: No; Group 2a: No; Group 2b: No; Group 3: No; Group 4: No;
0000106-97-8	Butane	OSHA	Select Carcinogen: No
		NTP	Known: No; Suspected: No
		IARC	Group 1: No; Group 2a: No; Group 2b: No; Group 3: No; Group 4: No;

Safety Data Sheet

Zero Rust 68SP Safety Blue (Aerosol)

SDS Revision Date:

02/27/2015

0000107-87-9	Methyl Propyl Ketone	OSHA	Select Carcinogen: No
		NTP	Known: No; Suspected: No
		IARC	Group 1: No; Group 2a: No; Group 2b: No; Group 3: No; Group 4: No;
0000108-65-6	PM Acetate	OSHA	Select Carcinogen: No
		NTP	Known: No; Suspected: No
		IARC	Group 1: No; Group 2a: No; Group 2b: No; Group 3: No; Group 4: No;
0000108-88-3	Toluene	OSHA	Select Carcinogen: No
		NTP	Known: No; Suspected: No
		IARC	Group 1: No; Group 2a: No; Group 2b: No; Group 3: Yes; Group 4: No;
0000123-86-4	N-Butyl Acetate	OSHA	Select Carcinogen: No
		NTP	Known: No; Suspected: No
		IARC	Group 1: No; Group 2a: No; Group 2b: No; Group 3: No; Group 4: No;
0064742-95-6	Solvent naphtha (petroleum), light aromatic	OSHA	Select Carcinogen: No
		NTP	Known: No; Suspected: No
		IARC	Group 1: No; Group 2a: No; Group 2b: No; Group 3: No; Group 4: No;

8.2. Exposure controls

Respiratory

If personal exposure cannot be controlled to below applicable limits by ventilation, wear a properly fitted organic vapor/particulate respirator approved by NIOSH/MSHA for protection against materials in Section 2. When sanding or abrading the dried film, wear a dust/mist respirator approved by NIOSH/MSHA for dust that may be generated from this product, underlying paint, or the abrasive.

Eyes

Wear safety glasses with side shields or goggles.

Skin

Impervious clothes to protect skin. Wash promptly when skin becomes contaminated. None required for normal application of aerosol products where minimal skin contact is expected. For long or repeated contact wear chemical resistant gloves.

Engineering Controls

Provide adequate ventilation. Where reasonably practicable this should be achieved by the use of local exhaust ventilation and good general extraction. If these are not sufficient to maintain concentrations of particulates and any vapor below occupational exposure limits suitable respiratory protection must be worn.

Other Work Practices

Use only with adequate ventilation. Avoid contact with skin and eyes. Wash hands after using. This coating may contain materials classified as nuisance particulates (listed as "Dust" in Section 2) that may be present at hazardous levels only during sanding or abrading of the dried coating. Use good personal hygiene practices. Wash hands before eating, drinking, smoking or using toilet. Promptly remove soiled clothing and wash thoroughly before reuse.

See section 2 for further details. - [Prevention]:

Safety Data Sheet

Zero Rust 68SP Safety Blue (Aerosol)

SDS Revision Date:

02/27/2015

9. Physical and chemical properties

Appearance	Blue Liquid/Gas
Odor	Solvent/Paint
Odor threshold	Not Measured
pH	Not Measured
Melting point / freezing point	Not Measured
Initial boiling point and boiling range	Not Measured
Flash Point	< 0F (Propellant)
Evaporation rate (Ether = 1)	Slower than ether
Flammability (solid, gas)	Gas
Upper/lower flammability or explosive limits	Lower Explosive Limit: Not Measured Upper Explosive Limit: Not Measured
Vapor pressure (Pa)	Not Measured
Vapor Density	> 1 (Heavier than Air)
Specific Gravity	0.817
Solubility in Water	Insoluble
Partition coefficient n-octanol/water (Log Kow)	Not Measured
Auto-ignition temperature	Not Measured
Decomposition temperature	Not Measured
Viscosity (cSt)	Not Measured
VOC Content	65% by wt maximum
Density (lbs/gal)	6.81
Maximum Incremental Reactivity	1.40 maximum

9.2. Other information

No other relevant information.

10. Stability and reactivity

10.1. Reactivity

Hazardous Polymerization will not occur.

10.2. Chemical stability

Stable under normal circumstances.

10.3. Possibility of hazardous reactions

No data available.

Safety Data Sheet

Zero Rust 68SP Safety Blue (Aerosol)

SDS Revision Date:

02/27/2015

10.4. Conditions to avoid

Do not expose to heat or store at temperature above 120°F

10.5. Incompatible materials

Oxidizing agents, strong acids.

10.6. Hazardous decomposition products

Carbon Monoxide and Carbon Dioxide

11. Toxicological information

Acute toxicity

Exposure to solvent vapor concentrations from the component solvents in excess of the stated occupational exposure limits may result in adverse health effects such as mucous membrane and respiratory system irritation and adverse effects on the kidneys, liver and central nervous system. Symptoms include headache, nausea, dizziness, fatigue, muscular weakness, drowsiness and in extreme cases, loss of consciousness.

Repeated or prolonged contact with the preparation may cause removal of natural fat from the skin resulting in dryness, irritation and possible non-allergic contact dermatitis. Solvents may also be absorbed through the skin. Splashes of liquid in the eyes may cause irritation and soreness with possible reversible damage.

2-butoxyethanol and its acetate are readily absorbed through the skin and will cause harmful effects on the blood.

Based upon animal testing, the C9 aromatic hydrocarbon components (trimethylbenzenes and ethylmethylbenzenes) are presumed to cause fetal toxicity and/or decreased fetal and newborn weights if overexposure occurs during the early gestation period.

Ingredient	Oral LD50, mg/kg	Skin LD50, mg/kg	Inhalation Vapor LD50, mg/L/4hr	Inhalation Dust/Mist LD50, mg/L/4hr	Inhalation Gas LD50, ppm
Acetone - (67-64-1)	2,000.00, Rat - Category: 4	2,000.00, Rabbit - Category: 4	76.00, Rat - Category: NA	No data available	No data available
Propane - (74-98-6)	No data available	No data available	658.00, Rat - Category: NA	No data available	No data available
Butane - (106-97-8)	No data available	No data available	658.00, Rat - Category: NA	No data available	No data available
Toluene - (108-88-3)	636.00, Rat - Category: 4	8,400.00, Rabbit - Category: NA	No data available	No data available	No data available
Solvent naphtha (petroleum), light aromatic - (64742-95-6)	6,800.00, Rat - Category: NA	3,400.00, Rabbit - Category: 5	No data available	No data available	No data available
Propane, 2-methyl- - (75-28-5)	No data available	No data available	658.00, Rat - Category: NA	No data available	No data available
N-Butyl Acetate - (123-86-4)	10,700.00, Rat - Category: NA	17,600.00, Rabbit - Category: NA	No data available	No data available	No data available

Safety Data Sheet

Zero Rust 68SP Safety Blue (Aerosol)

SDS Revision Date:

02/27/2015

Methyl Propyl Ketone - (107-87-9)	1,600.00, Rat - Category: 4	6,500.00, Rabbit - Category: NA	No data available	No data available	No data available
PM Acetate - (108-65-6)	8,532.00, Rat - Category: NA	5,000.00, Rabbit - Category: 5	No data available	No data available	4,345.00, Rat - Category: NA

Note: When no route specific LD50 data is available for an acute toxin, the converted acute toxicity point estimate was used in the calculation of the product's ATE (Acute Toxicity Estimate).

Classification	Category	Hazard Description
Acute toxicity (oral)	5	May be harmful if swallowed. (Not adopted by US OSHA)
Acute toxicity (dermal)	---	Not Applicable
Acute toxicity (inhalation)	---	Not Applicable
Skin corrosion/irritation	2	Causes skin irritation.
Serious eye damage/irritation	2	Causes serious eye irritation.
Respiratory sensitization	---	Not Applicable
Skin sensitization	---	Not Applicable
Germ cell mutagenicity	---	Not Applicable
Carcinogenicity	---	Not Applicable
Reproductive toxicity	2	Suspected of damaging the unborn child.
STOT-single exposure	3	May cause drowsiness or dizziness.
STOT-repeated exposure	2	May cause damage to organs through prolonged or repeated exposure.
Aspiration hazard	---	Not Applicable

12. Ecological information

12.1. Toxicity

Toxic to aquatic life

Aquatic Ecotoxicity

Ingredient	96 hr LC50 fish, mg/l	48 hr EC50 crustacea, mg/l	ErC50 algae, mg/l
Acetone - (67-64-1)	100.00, Pimephales promelas	10.00, Daphnia magna	20.565 (72 hr), Ulva pertusa

Safety Data Sheet

Zero Rust 68SP Safety Blue (Aerosol)

SDS Revision Date:

02/27/2015

Propane - (74-98-6)	Not Available	Not Available	Not Available
Butane - (106-97-8)	6.00, Fish (Piscis)	Not Available	Not Available
Toluene - (108-88-3)	5.80, Oncorhynchus mykiss	19.60, Daphnia magna	Not Available
Solvent naphtha (petroleum), light aromatic - (64742-95-6)	9.22, Oncorhynchus mykiss	6.14, Daphnia magna	19.00 (72 hr), Selenastrum capricornutum
Propane, 2-methyl- - (75-28-5)	Not Available	Not Available	Not Available
N-Butyl Acetate - (123-86-4)	18.00, Pimephales promelas	32.00, Artemia salina	674.70 (72 hr), Scenedesmus subspicatus
Methyl Propyl Ketone - (107-87-9)	1,240.00, Pimephales promelas	Not Available	0.00 (96 hr),
PM Acetate - (108-65-6)	100.00, Salmo gairdneri	500.00, Daphnia magna	Not Available

12.2. Persistence and degradability

There is no data available on the preparation itself.

12.3. Bioaccumulative potential

Not Measured

12.4. Mobility in soil

No data available.

12.5. Results of PBT and vPvB assessment

This product contains no PBT/vPvB chemicals.

12.6. Other adverse effects

No data available.

13. Disposal considerations

13.1. Waste treatment methods

Observe all federal, state and local regulations when disposing of this substance.

14. Transport information

	DOT (Domestic Surface Transportation)	IMO / IMDG (Ocean Transportation)	ICAO/IATA
14.1. UN number	UN1950	UN1950	UN1950
14.2. UN proper shipping name	UN1950, Aerosols, Limited Quantity, 2.1,	Aerosols, Limited Quantity	Aerosols, Limited Quantity
14.3. Transport hazard class(es)	DOT Hazard Class: 2.1	IMDG: 2.1	Air Class: 2.1
14.4. Packing group	Not Applicable	Not Applicable	Not Applicable

Safety Data Sheet

Zero Rust 68SP Safety Blue (Aerosol)

SDS Revision Date:

02/27/2015

14.5. Environmental hazards

IMDG Marine Pollutant: No

14.6. Special precautions for user

No further information

14.7. Transport in bulk according to Annex II of MARPOL73/78 and the IBC Code

Not Applicable

15. Regulatory information

Regulatory Overview The regulatory data in Section 15 is not intended to be all-inclusive, only selected regulations are represented.

Toxic Substance Control Act (TSCA) All components of this material are either listed or exempt from listing on the TSCA Inventory.

WHMIS Classification A D2A

US EPA Tier II Hazards

Fire: Yes

Sudden Release of Pressure: Yes

Reactive: No

Immediate (Acute): Yes

Delayed (Chronic): Yes

EPCRA 311/312 Chemicals and RQs (lbs):

Acetone (5,000.00)

N-Butyl Acetate (5,000.00)

Toluene (1,000.00)

EPCRA 302 Extremely Hazardous:

To the best of our knowledge, there are no chemicals at levels which require reporting under this statute.

EPCRA 313 Toxic Chemicals:

Toluene

Proposition 65 - Carcinogens (>0.0%):

To the best of our knowledge, there are no chemicals at levels which require reporting under this statute.

Proposition 65 - Developmental Toxins (>0.0%):

Toluene

Proposition 65 - Female Repro Toxins (>0.0%):

To the best of our knowledge, there are no chemicals at levels which require reporting under this statute.

Proposition 65 - Male Repro Toxins (>0.0%):

To the best of our knowledge, there are no chemicals at levels which require reporting under this statute.

New Jersey RTK Substances (>1%):

Acetone

Safety Data Sheet

Zero Rust 68SP Safety Blue (Aerosol)

SDS Revision Date:

02/27/2015

Butane
Methyl Propyl Ketone
N-Butyl Acetate
Propane
Propane, 2-methyl-
Toluene

Pennsylvania RTK Substances (>1%):

Acetone
Butane
Methyl Propyl Ketone
N-Butyl Acetate
Propane
Propane, 2-methyl-
Toluene

16. Other information

The information and recommendations contained herein are based upon data believed to be correct. However, no guarantee or warranty of any kind, expressed or implied, is made with respect to the information contained herein. We accept no responsibility and disclaim all liability for any harmful effects which may be caused by exposure to our products. Customers/users of this product must comply with all applicable health and safety laws, regulations, and orders.

The full text of the phrases appearing in section 3 is:

H220 Extremely flammable gas.
H225 Highly flammable liquid and vapor.
H226 Flammable liquid and vapor.
H280 Contains gas under pressure; may explode if heated.
H302 Harmful if swallowed.
H304 May be fatal if swallowed and enters airways.
H315 Causes skin irritation.
H319 Causes serious eye irritation.
H335 May cause respiratory irritation.
H336 May cause drowsiness and dizziness.
H361d Suspected of damaging the unborn child.

Safety Data Sheet
Zero Rust 68SP Safety Blue (Aerosol)

SDS Revision Date:

02/27/2015

H373 May cause damage to organs through prolonged or repeated exposure.

This is the first version in the GHS SDS format. Listings of changes from previous versions in other formats are not applicable.

IMPORTANT NOTE: This information is furnished without warranty, expressed or implied, as to accuracy or completeness. The information is obtained from various sources including the manufacturer and other third party sources. The information may not be valid under all conditions nor if this material is used in combination with other materials or any process. Final determination of suitability of any material is the sole responsibility of the user.

End of Document